

COMPLETION PRODUCTS

BEST AVAILABLE COPY

TUBING/CASING PATCHES

Halliburton's tubing/casing patches provide a heavy-duty permanent seal over splits, holes, or perforations in tubing and casing. The patches are run on electric wireline or tubing and set with a special pressure-setting tool that has a special charge similar to that used to set a permanent packer. These patches feature large bores to allow passage of tools and equipment and minimize restriction to fluid flow.

Tubing/casing patches have three components:

- Top soft metal element with a rubber seal
- Tubular extension with threaded ends
- Bottom soft metal element with a rubber seal

Various patch lengths and bottom elements are swaged outward during the setting process. The tubular extension is not swaged. During setting, the pressure setting tool exerts a pushing force on the top tapered swage and a pulling force on the bottom tapered swage. Both swages are driven into the soft metal elements that expand and seal against the casing bore. At a predetermined force, a calibrated weak point shears in the setting tool, and the setting process ceases. A collapsible setting collet located in the bottom swage retracts and allows the pressure-setting tool and setting equipment to be retrieved. The damage interval is now isolated by a full circle metal-to-metal and rubber seal.

Note: Halliburton recommends the use of a casing scraper before patch installation to clear out foreign matter. We also recommend the use of a casing caliper to provide an accurate record of casing ID and condition.

Applications

- Repairing casing splits, parts, milled windows, dogleg wear points, and corrosion leaks
- Isolating a side pocket mandrel
- Isolating old perforations
- Repairing tubing and collar leaks

Features

- Pressure-setting tool with positive release provides quick, dependable patch setting
- Metal elements and elastomeric backups provide a positive seal
- Modular design using 10-ft extensions


Benefits

- Repairs can be made quickly, reducing down time
- Can be run in and set under pressure using electric wireline or run in on tubing

- Can be set permanently in a variety of tubing or casing sizes
- Can be retrieved in most cases using conventional fishing methods

Options

- A variety of lengths are available up to 150 ft in some sizes

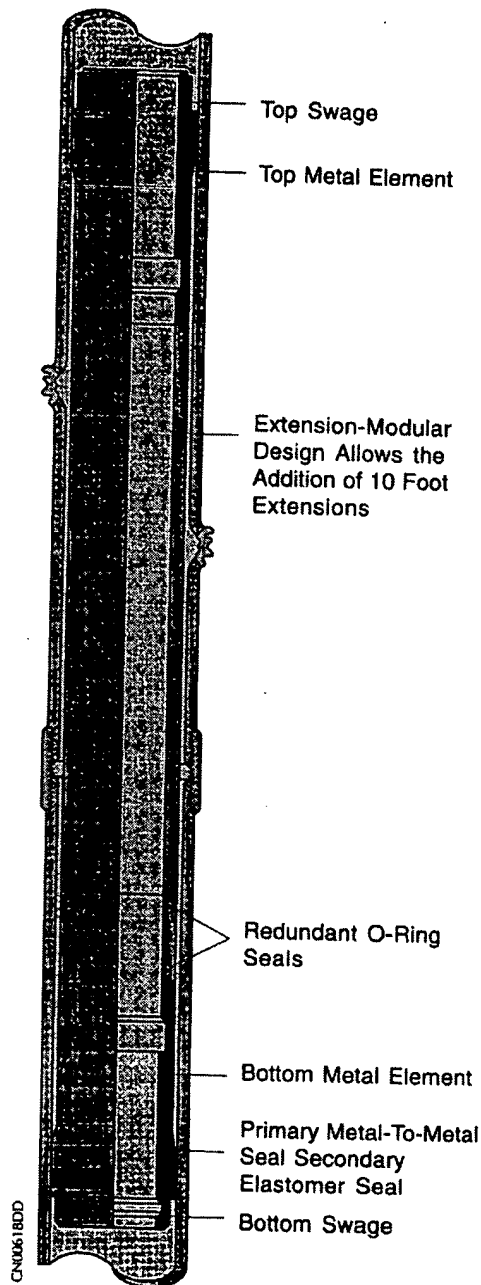

Tubing/Casing Patches

North America
Halliburton Center
5151 San Felipe
Houston, Texas 77056

Phone: 713-624-7200
Fax: 713-624-7201

South America

Halliburton

1900 Ave. de la Paz, 10

Caracas

Venezuela

Phone: 58-212-524-5000

Fax: 58-212-524-5001

Latin America

Halliburton Center

5151 San Felipe

Houston, Texas 77056

USA

Phone: 713-624-7200

Fax: 713-624-7201

Middle East/Chs

1101-1104 Al Fakhra Tower

Abu Dhabi Highway

P.O. Box 1171

Dubai

United Arab Emirates

Phone: 973-411-1100

Fax: 973-411-1101

Asia Pacific Region

22 de Mayo

Manila, Philippines

Phone: 632-888-8888

Fax: 632-888-8889

Phone: 632-888-8888

Fax: 632-888-8889

Phone: 632-888-8888

Fax: 632-888-8889

For information regarding equipment

contact your local office

or write to:

Halliburton Energy Services

Quincy, IL 62450

Phone: 618-632-7200

Fax: 618-632-7201



Sales of Halliburton products and services will be in accord solely with the terms and conditions contained in the contract between Halliburton and the customer that is applicable to the sale.

**This Page is Inserted by IFW Indexing and Scanning
Operations and is not part of the Official Record**

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

- ☐ **BLACK BORDERS**
- ☐ **IMAGE CUT OFF AT TOP, BOTTOM OR SIDES**
- ☐ **FADED TEXT OR DRAWING**
- ☐ **BLURRED OR ILLEGIBLE TEXT OR DRAWING**
- ☐ **SKEWED/SLANTED IMAGES**
- ☒ **COLOR OR BLACK AND WHITE PHOTOGRAPHS**
- ☐ **GRAY SCALE DOCUMENTS**
- ☐ **LINES OR MARKS ON ORIGINAL DOCUMENT**
- ☐ **REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY**
- ☐ **OTHER:** _____

IMAGES ARE BEST AVAILABLE COPY.

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.